


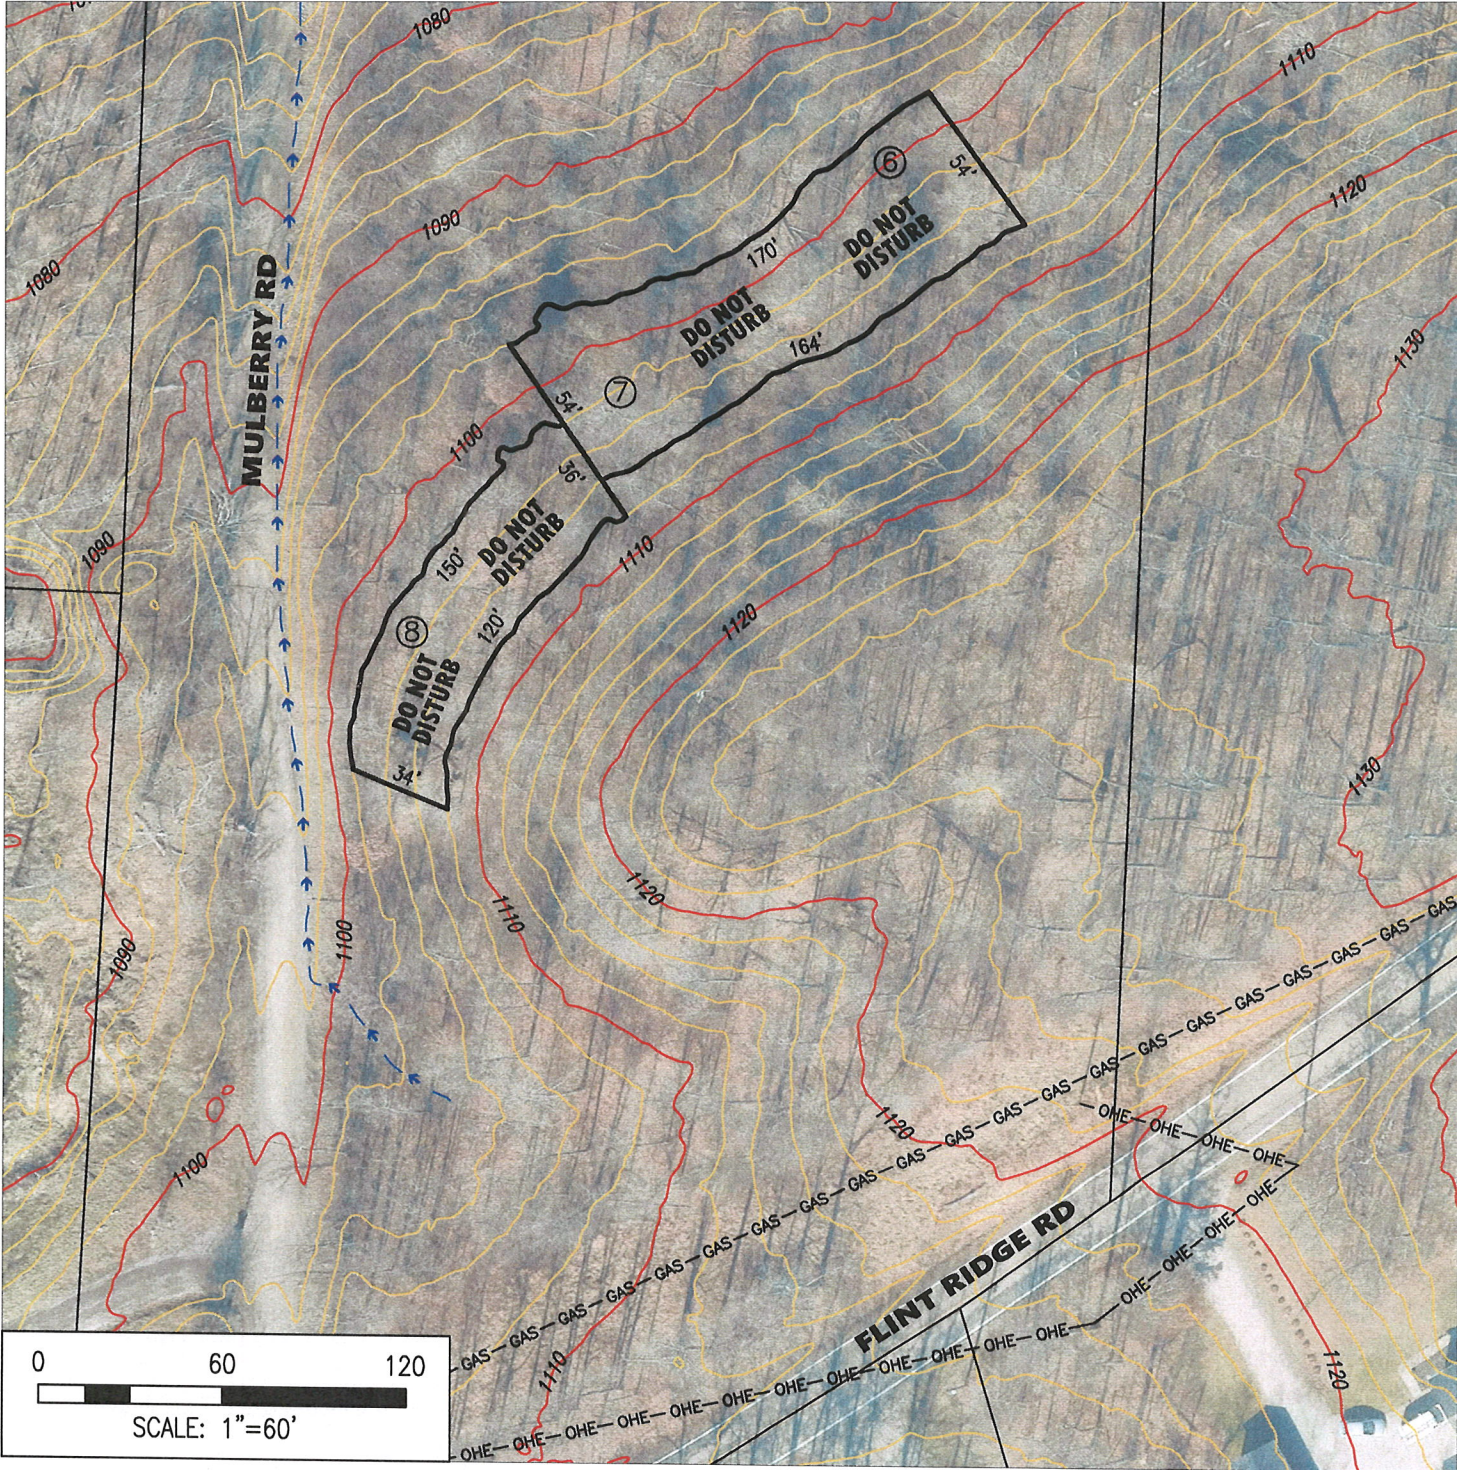

NOTE: SITE PLAN PREPARED USING GARMIN GPS, LICKING CO., AND OGRIP GIS DATA. DATA SHOWN IS ASSUMED CORRECT, BUT HAS NOT BEEN SURVEYED. HOUSE, WELL, BURIED UTILITIES AND DRIVEWAY LOCATIONS, IF SHOWN, ARE NOT FINAL. ALL SHOULD BE SITUATED ON THE LOT TO ALLOW FOR AN ON LOT SYSTEM THAT MEETS, OR EXCEEDS, THE MINIMUM SIZE REQUIRED.

976 McIntire Ave.
Zanesville, OH 43701
740-704-1879
www.roxsol.com

LOCATION MAP

LEGEND

- LOT
- TEST PIT
- DRAINAGE

NOTE: DO NOT DISTURB DESIGNATED LEACH FIELD AREAS UNTIL INSTALLATION

COUNTRYTIME
C/O JEFFREY LONGHENRY
0 FLINT RIDGE RD.,
NEWARK, OHIO 43055

PARCEL: 033-103422-00.008

2' CONTOUR INTERVAL

SCALE: 1"=60'

DATE	2/3/25	
REVIEWED BY	KB	

Lot 7

Site and Soil Evaluation for Sewage Treatment and Dispersal

County: LICKING

Township / Sec.: HOPEWELL

Property Address/Location: 0 FLINT RIDGE RD.
NEWARK, OH 43055

Applicant Name: COUNTRYTyme-J. LONGHENRY
Address: 3451 CINCINNATI-ZANESVILLE RD.
LANCASTER, OH 43130

Phone #: (614) 989-9394

Lot #: 033-103422-00.008
8

Test Hole #: 39.9876, -82.24421

Latitude/Longitude: 39.9876, -82.24421

Method: Pit Auger ☒ Probe

Land Use / Vegetation: UNDEVELOPED WOODS

Landform: UPLAND

Position on Landform: HILLSLOPE

Percent Slope: 10-12%

Shape of Slope: CONVEX

Date: February 3, 2025

Evaluator: KYLE BALDWIN, GEOLOGIST

Signature: KYLE BALDWIN

Phone#: 740-704-1879

AOP SOILS PROFESSIONAL
ODH APPROVED SOIL EVALUATOR

Soil Profile		Estimating Soil Saturation				Estimating Soil Permeability					Loading Rates			
Horizon	Depth (inches)	Matrix Color	Munsell Color (hue, value, chroma)		Class	Texture		Structure		Consistence	Infiltration		Linear g/d/ft	
			Concentrations	Depletions		Approx. % Clay	Approx. % Fragments	Size	Type (shape)		>30BOD	<30BOD		
Ao	2	10YR 3/3			SIL	20	0		F		FR	0.6	0.8	TBD
BE	10	10YR 5/3			SIL	20	0		F		FR	0.6	0.8	TBD
Bt1	28	10YR 5/4	10YR 5/6		SIL	20	0		M		FR	0.6	0.8	TBD
Bt2	36	10YR 5/4	10YR 5/6	10YR 6/2	SICL	30	5		M		FI	0.4	0.6	TBD
BC	48	10YR 5/4	10YR 5/6	10YR 6/1	SICL	30	10		CO		FI	0.4	0.6	TBD
C	60	10YR 5/4	10YR 5/6	10YR 6/1	SICL	30	10		0		FI	0.0	0.0	TBD

Limiting Conditions		Depth to (in.)	Descriptive Notes	Remarks / Risk Factors/ Soil Rating:
Perched Seasonal Water Table	28	REDOXIMORPHIC FEATURES PRESENT		
Apparent Water Table	N/O	NOT OBSERVED		
Highly Permeable Material	N/O	NOT OBSERVED		SOIL RATING: SOMEWHAT LIMITED
Bedrock	N/O	NOT OBSERVED		
Restrictive Layer	48	STRUCTURELESS		

Note : The evaluation should include a complete site plan or site drawing.

Site and Soil Evaluation for Sewage Treatment and Dispersal

County: LICKING

Township / Sec.: HOPEWELL

Property Address/Location: 0 FLINT RIDGE RD.
NEWARK, OH 43055

Applicant Name: COUNTRYTYME-J. LONGHENRY

Address: 3451 CINCINNATI-ZANESVILLE RD.
LANCASTER, OH 43130

Phone #: (614) 989-9394

Lot #: 033-103422-00.008

Test Hole #: 7

Latitude/Longitude: 39.98782, -82.24396

Method: Pit Auger X Probe

Land Use / Vegetation: UNDEVELOPED WOODS

Landform: UPLAND

Position on Landform: HILLSLOPE

Percent Slope: 10-12%

Shape of Slope: CONVEX

Date: February 3, 2025

Evaluator: KYLE BALDWIN, GEOLOGIST

AOP SOILS PROFESSIONAL

ODH APPROVED SOIL EVALUATOR

Certification #

Signature: KYLE BALDWIN

Phone#: 740-704-1879

Soil Profile		Estimating Soil Saturation				Estimating Soil Permeability						Loading Rates		
Horizon	Depth (inches)	Munsell Color (hue, value, chroma)		Redoximorphic Features		Texture			Structure			Infiltration		Linear
		Matrix Color	Concentrations	Depletions	Class	Approx. % Clay	Approx. % Fragments	Grade	Size	Type (shape)	Consistence	>30BOD	<30BOD	g/d/ft
Ao	2	10YR 3/3			SIL	20	0	3	F	GR	FR	0.6	0.8	TBD
BE	10	10YR 5/3			SIL	20	0	2	F	SBK	FR	0.6	0.8	TBD
Bt1	28	10YR 5/4	10YR 5/6		SIL	20	0	2	M	SBK	FR	0.6	0.8	TBD
Bt2	36	10YR 5/4	10YR 5/6	10YR 6/2	SICL	30	5	2	M	SBK	FI	0.4	0.6	TBD
BC	48	10YR 5/4	10YR 5/6	10YR 6/1	SICL	30	10	2	CO	SBK	FI	0.4	0.6	TBD
C	60	10YR 5/4	10YR 5/6	10YR 6/1	SICL	30	10	0	0	0	FI	0.0	0.0	TBD
Limiting Conditions		Depth to (in.)		Descriptive Notes		Remarks / Risk Factors/ Soil Rating:								
Perched Seasonal Water Table		28		REDOXIMORPHIC FEATURES PRESENT										
Apparent Water Table		N/O		NOT OBSERVED										
Highly Permeable Material		N/O		NOT OBSERVED		SOIL RATING: SOMEWHAT LIMITED								
Bedrock		N/O		NOT OBSERVED										
Restrictive Layer		48		STRUCTURELESS										

Note : The evaluation should include a complete site plan or site drawing.